



R24-00034_3rd Submittal Plan.pdf Markup Summary

Cloud+ (2)



Subject: Cloud+
Page Label: [37] 37 4375.50_IMP 37 - Layout
Author: David Abbott
Date: 1/13/2026 2:08:10 PM
Status:
Color: ■
Layer:
Space:


FD: Response letter stated the second access point was now shown for this area, but plan does not appear to show it. Please update throughout.

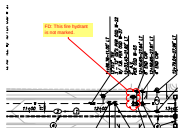

Subject: Cloud+
Page Label: [16] 16 4375.50_IMP 16-PDC
Author: David Abbott
Date: 1/13/2026 12:21:00 PM
Status:
Color: ■
Layer:
Space:

FD: This fire hydrant is not marked.

Text Box (3)



Subject: Text Box
Page Label: [37] 37 4375.50_IMP 37 - Layout
Author: David Abbott
Date: 1/13/2026 2:08:05 PM
Status:
Color: ■
Layer:
Space:

FD:
1. Please update turning template to include oceanside fire's worst turning apparatus. Please reach out to dabbott@oceansideca.org for that information.
2. Please include width of roads/lanes on turning template.



Subject: Text Box
Page Label: [1] PDC
Author: David Abbott
Date: 1/13/2026 2:08:20 PM
Status:
Color: ■
Layer:
Space:

FD: Are the bollards temporary? A manual gate is preferred as both a temporary and permanent solution to the road served. Please replace bollards with a gate and provide details.

If bollards are necessary for the project on a temporary basis, please reach out to dabbott@oceansideca.org for further communication.



Subject: Text Box
Page Label: [5] 5 4375.50_IMP 5 - PDC
Author: David Abbott
Date: 1/13/2026 11:44:40 AM
Status:
Color: ■
Layer:
Space:

FD:
1. Fire hydrants shall be spaced in accordance with Appendix C/CC of the 2022 CFC. Please update spacing as needed. Some fire hydrants appear to be over spaced.
Note: If easier to convey spacing, please feel free to provide an overall site plan of the roads with locations of the fire hydrants (may be shown on the turning template, provided it's to scale)

2. Fire Hydrants shall have one 4" and two 2.5" outlets